

# **TEST REPORT**

Report No. ..... : WTF23F01004655C

Applicant .....: Mid Ocean Brands B.V.

Address ...... : 7/F., Kings Tower, 111 King Lam Street, Cheung Sha Wan,

Kowloon, Hong Kong

Manufacturer..... 114276

Sample Name ...... Stainless steel cutlery set

Sample Model ..... : MO6149

Test Requested....: Client's requirements - Dishwasher safe test.

Test Conclusion .....: Refer to next page (s)

Date of Receipt sample..... : 2023-01-09

**Testing period**...... 2023-01-09 to 2023-01-30

Date of Issue ...... 2023-01-30

Test Result ...... : Refer to next page (s)

Prepared By:

Waltek Testing Group (Foshan) Co., Ltd.

Address: No.13-19, 2/F., 2nd Building, Sunlink International Machinery City, Chencun, Shunde District, Foshan, Guangdong, China
Tel:+86-757-23811398 Fax:+86-757-23811381 E-mail:info@waltek.com.cn

Signed for and on behalf of Waltek Testing Group (Foshan) Co., Ltd.

Swing.Liang



# Sample photo:





### **Test Results:**

### Dishwasher safe test (In House Method)


No. of Cycles	:	(10) cycles (Sample No.1&No.2&No.3&No.4&No.5)
Dishwasher		Siemens SD6P1S
Detergent Brand	3	Cascade
Washing condition	:<	the out with the sail of
1. Cycle Time	316	~ 90 Minutes.
2. Cycle Water Temperature	:4	Main Wash ~ 140°F (60°C) Rinse ~ 161°F (72°C)
3. Location inside dishwasher		Bottom rack
Testing Procedure	in,	<ol> <li>1) Visually inspect sample and record any aesthetic defects.</li> <li>2) Load into the dishwasher and run the wash cycle as per the above condition.</li> <li>3) Examine from a distance of ~ 30cm and record any difference as compared with the control sample.</li> <li>4) Repeat 2) ~ 3) until the required number of cycle is completed.</li> </ol>
Test Requirement	N. L.T. E	No discoloration, deformation, staining of water (water mark), or substantial deterioration of item's appearance and/or function.
Conclusion(s)		PASS  1. No noticeable change in appearance / size was found on the sample(s)  2. The tested sample(s) remained functional

# **Description for Specimen:**

Specimen No.	Specimen Description
in the state of	Stainless steel cutlery set - Brush (Overall individual)
t nite in 2 mile in	Stainless steel cutlery set - Knife (Overall individual)
3 (1)	Stainless steel cutlery set - Suction tube (Overall individual)
with the 4 min and	Stainless steel cutlery set - Fork (Overall individual)
THE THE STATE METERS	Stainless steel cutlery set - Spoon (Overall individual)



# Photograph of parts tested:

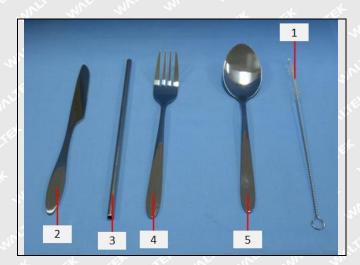





#### Remarks:

- 1. The results shown in this test report refer only to the sample(s) tested;
- 2. This test report cannot be reproduced, except in full, without prior written permission of the company;
- 3. The report would be invalid without specific stamp of test institute and the signatures of compiler and approver;
- 4. The Applicant name and Address, the sample(s) and sample information was/were provided by the applicant who should be responsible for the authenticity which Waltek hasn't verified;
- 5. If the report is not stamped with the accreditation recognized seal, it will only be used for scientific research, education, and internal quality control activities, and is not used for the purpose of issuing supporting data to the society.
- 6. The sample material information (Model No. information) is provided by client, not verified by test laboratory. The samples of reference Model No. are not tested. Test laboratory not responsible for the accuracy, appropriateness, completeness and authenticity of the information provided by client.

===== End of Report =====



